



## RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

|  |                     |                          |                         |                                    |  |                   |
|--|---------------------|--------------------------|-------------------------|------------------------------------|--|-------------------|
| FACILITY NAME<br>PRR HOMEOWNERS ASSOCIATION        |                     |                          |                         | REINSPECTION DATE<br>Not Specified | INSPECTOR<br>Yanan Zhu   | DATE<br>6/17/2016 |
| LOCATION<br>2600 LOOKOUT CR, CHINO HILLS, CA 91710 |                     |                          |                         | PERMIT EXPIRATION<br>2/28/2017     | IDENTIFIER: Spa<br>SERVICE: 003 - INSPECTION - FOLLOW UP INSPECTION<br>RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQ<br>ACTION: 13 - PERMIT SUSPENDED / FACILITY CLOSED |                   |
| TIME IN<br>3:31 PM                                 | TIME OUT<br>4:29 PM | FACILITY ID<br>FA0005359 | RELATED ID<br>PR0015097 | PE<br>3623                         |  |                   |



### RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional inspection to be billed at the hourly rate as provided in the San Bernardino County Code, [Schedule of Fees](#).

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

|                   |
|-------------------|
| Ideal             |
| In Compliance     |
| Not in Compliance |

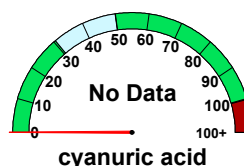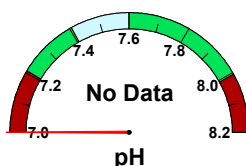

|                     |         |
|---------------------|---------|
| temperature (°F)    | No Data |
| observed flow (gpm) | No Data |
| required flow (gpm) | 65      |
| volume (gal)        | 1,945   |
| area (sq ft)        | 113     |
| occupancy           | 11      |

#### IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

#### 36K995 Permit - Suspension



POINTS  
**NA**

Compliance Date: Not Specified  
Not In Compliance  
Violation Reference - HSC

**Inspector Comments:** Reinspection conducted at this time, free-chlorine level to be at 0.26 ppm at the time of inspection.  
The health permit to operate is hereby suspended and the pool/spa ordered closed until the listed violation(s) have been corrected and verified by Environmental Health Services (EHS). The facility is to remain closed until permission from EHS is given. Contact your inspector at your local office to schedule a reinspection to reinstate the health permit. The facility is posted closed; do not move, hide, or remove the sign. Reopening of the pool/spa without the approval by EHS, may result in an hourly billable Professional Services fee.

**Violation Description:** Violation(s) observed pose an immediate threat to public health and safety. The health permit to operate is hereby suspended and the pool/spa ordered closed until the listed violation(s) have been corrected and verified by Environmental Health Services (EHS). The facility is to remain closed until permission from EHS is given. Contact your inspector at your local office to schedule a reinspection to reinstate the health permit. The facility is posted closed; do not move, hide, or remove the sign. Reopening of the pool/spa without the approval by EHS, may result in an hourly billable Professional Services fee.

#### 36K994 Reinspection

POINTS  
**NA**

Compliance Date: Not Specified  
Not In Compliance  
Violation Reference - HSC

**Inspector Comments:** Reinspection conducted at this time, free-chlorine level to be at 0.26 ppm at the time of inspection.

**Description:** Reinspection conducted at this time to determine compliance from prior inspection.

#### 36K548 Equipment - General Requirements - System Description

POINTS  
**1**

Compliance Date: Not Specified  
Not In Compliance  
Violation Reference - CCR 24 - 3123B.1

**Inspector Comments:** Observed sight glass is missing from the backwashing pipe. Provide a sight glass in backwashing pipe after the separation tank.

**Violation Description:** Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The system shall consist of pumps, filters, chemical feeders, skimmers or perimeter overflow systems, valves, pipes, connections, fittings and appurtenances.



## RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

|  |                        |
|--|------------------------|
| FACILITY NAME<br>PRR HOMEOWNERS ASSOCIATION        | DATE<br>6/17/2016      |
| LOCATION<br>2600 LOOKOUT CR, CHINO HILLS, CA 91710 | INSPECTOR<br>Yanan Zhu |

### 36K552 Equipment - Flow meter provided

**POINTS****1**

Compliance Date: Not Specified  
Not In Compliance  
Violation Reference - CCR 24 -  
3125B.3

**Inspector Comments:** Observed flow meter not functioning at the time of inspection. Replace/repair.

**Violation Description:** A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow and installed according to the manufacturer's written instructions with increments in the range of normal flow.

### 36K554 Equipment - Pressure/Vacuum gauge requirements

**POINTS****1**

Compliance Date: Not Specified  
Not In Compliance  
Violation Reference - CCR 24 -  
3125B.2

**Inspector Comments:** Observed gauge on top of filter was not marked for clean start up pressure reading. Provide as described below.

**Violation Description:** A pressure and vacuum gauge shall be provided for each pump system. Each gauge shall have a scale range approximately 1 ¼ times the maximum anticipated working pressure or vacuum and shall be accurate within 2 percent of scale. The pressure gauge located on the filter shall be marked with the clean start up pressure reading.

### 36K560 Equipment – Waste water

**POINTS****1**

Compliance Date: Not Specified  
Not In Compliance  
Violation Reference - CCR - 3141B

**Inspector Comments:** Observed no air gap between wastewater/backwash pipe and wastewater drain. Provide an at least one inch gap between wastewater/backwash pipe and wastewater drain.

**Violation Description:** There shall be no direct connection between the pool, its recirculation system or overflow drain to any sanitary sewer, storm drain or drainage system.

Material cleaned from filters and backwash water from any recirculation system shall be disposed in a manner that is acceptable to the local wastewater agency and will not create a nuisance. Backwash water shall not be returned to a pool. Pipes carrying wastewater from pools including pool drainage and backwash from filters shall be installed as an indirect waste in accordance with the requirements of Chapter 8 of the California Plumbing Code.

The backwash from a diatomaceous earth filter shall discharge into a separation tank that has been installed to collect the waste diatomaceous earth mixture. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

### Overall Inspection Comments

No summary comments have been made for this inspection.

### Signature(s) of Acknowledgement

NAME: Signature not available  
TITLE:

Total # of Images: 0